

TILLAMOOK COUNTY SURVEYORS OFFICE

Section corner common to sections 25 & 36, T.2S.,R.10W.,W.M.

and sections 30 & 31, T.2S.,R.9W.,W.M.

T2S
R10W R9W
S25|S30
----+----
S36|S31
1976
LS 849

I found a 2" iron pipe with a 3" Crown Zellerbach brass cap, (See Tillamook County Surveyors rewitmess book 6 page 4). I set an irregular mass of concrete around the found iron pipe.

History of found Monument

I found this monument to be as reported on the above said rewitmess, and in Tillamook County Surveyors rewitmess book 2 at page 406, and the accessories found and/or set at that time to now be as follows:

Original 30" hemlock S.54*W. 53 lks., reported as stump remains of original bearing tree S.52*W. 35.0', old face and scribing visible, in said rewitmess book 6, and as a 30" hemlock stump at original bearing and distance in said rewitmess book 2; (Found now rotten hemlock stump with iron marks still visible on rotten face).

6" spruce S.48*30'W. 18.', set in book 2, reported as bear killed in said book 6; (now 16" rotten snag).

8" fir N.76*30'W. 38', set in book 2, reported as found in said book 6; (now a 21" short stump, face overgrown).

19" hemlock S.76*30'E. 8' set in book 2, reported as found in said book 6; (now a 34" hemlock, face overgrown, 7.11' to a finish nail with a Tillamook County Surveyors brass washer in small blaze on a root flair. Found yellow location poster attached).


*8" hemlock N.73*E. 18', set in book 2, reported as found in said book 6; (now a 22", 6' high stump, face overgrown, 17.44' to a finish nail with a Tillamook County Surveyors brass washer in a small blaze near the root crown).

*12" hemlock S.14*W. 16.6' to face, set in book 6, (now a 23" hemlock, face overgrown, 16.50' to a finish nail with a Tillamook County Surveyors brass washer in a small blaze low on the tree).

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Allan E. Duncan, C.S.

OREGON
JULY 14, 1967
ALLAN E. DUNCAN
793

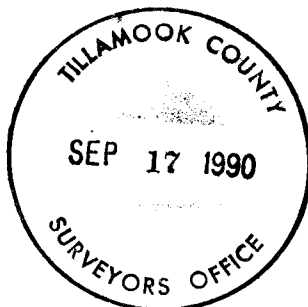

page 1 of 2

TILLAMOOK COUNTY SURVEYORS OFFICE

New Accessories

*72" light hat section post North 1.5'

= Indicated yellow Tillamook County corner tag affixed.

Surveys of reference

B-737	1976	Carl F. Foeste L.S.849
B-738	1976	Carl F. Foeste L.S.849
B-1231	1986	Gregory A. Crites L.S.1887
Rewitness book 2	page 406	1957 Mervin Whitmore U.S.F.S.
Rewitness book 6	page 4	1976 Carl F. Foeste L.S. 849

Monument Location

This corner is located approximately 50' East of a spur ridge top in an East-West cutting line.

In the presence of Dan McNutt & Al Dvorak

September 1990

Title



REGISTERED
PROFESSIONAL
LAND SURVEYOR

Allan E. Duncan, C.S.

OREGON
JULY 14, 1967
ALLAN E. DUNCAN
793

Page 2 of 2

BOOK 6 500-B