

TILLAMOOK COUNTY SURVEYORS OFFICE
COURT HOUSE, TILLAMOOK OREGON 97141

SECTION CORNER COMMON SECTIONS 9, 10, 15, & 16 T.3S., R.10W., W.M.

T3SR10W I found a 2 1/2" iron pipe with a 3" B.L.M Brass cap
S 9| S10 (see T.C.S. Rewitness Book 6 at Page 99). I encased
----+---- the found iron pipe and brass cap in a 10" concrete
S16| S15 cylinder.
1978

History of found monument

I found this monument to be as described in T.C.S. Rewitness Book 6 at page 99 and the references found and/or set at that time to now be as follows:

(Original) 20" hemlock S.75 W. 79 lks, Reported in Book 1 at page 239 as a badly decayed stump scribe marks visible, but not legible, and Reported in book 6 at page 99 as a decayed hemlock stump, no marks visible on open blaze, and on T.C.S. Map B-1085 as just remnants; (Found, now just remnants under a fallen log).

(Original) 24" hemlock N.59 W. 34 lks, Reported in Book 1 at page 239 as fallen hemlock with scribe marks on underside, and Reported in book 6 at page 99 as a root hole with down and decayed hemlock alongside scribe marks "BT" visible on open blaze; (Found, now rotten uproot).

(Whitmore Book 1 Page 239) 7" fir N.44 W. 34 feet changed to 10' by unknown person, reported in Book 6 at page 98 as a 14" fir N.40 W. 15.5 lks distance with healed blaze, and reported on T.C.S. Map B-1085 as a 15" D. fir N.39 W. 10'; (Found, now 16" fir with healed blaze N.39 W. 10' to approximated center of tree).

(Whitmore Book 1 Page 239) 8" fir N.55 E. 10.5 feet, and reported in Book 6 at page 99 as a 14" fir N.55 E. 17.5 lks distance with healed blaze, and reported on T.C.S. Map B-1085 as a 14" D. fir N.55 E. 11.4'; (Found, now 15" fir with healed blaze N.55 E. 11.4' to approximated center of tree).

(Whitmore Book 1 Page 239) 6" fir S.14 E. 24.5 feet reported in Book 6 at page 99 as a 14" fir S.15 W. 37 lks distance with healed blaze, and reported on T.C.S. Map B-1085 as a 15" D. fir S.14 E. 24.5'; (Found, now 16" fir stump 7' tall with healed blaze S.20 E. 24.5' to approximated center of stump).

(Whitmore Book 1 Page 239) 10" spruce S.34 W. 25.5 feet, reported in Book 6 at page 98 as a 14" spruce S.34 W. 39 lks distance with healed blaze, and reported on T.C.S. Map B-1085 as a 14" Dead spruce S.34 W. 25.5'; (Found, now 15" spruce stump 6' high with rotten face visible in partially healed blaze S.34 W. 26.5' to upper blaze).

(T.C.S. Map B-1085) 16" D. fir S.8 W. 5.9'; (Found, Now a 17" fir stump 7' tall with healed face. Distance measured to a nail in the E. side center of the tree).

Found 1" iron pipe 3' high 1.3' easterly of corner monument.

Found steel fence post with yellow U.S.F.S. tag 3' Southerly of corner.

Found orange carsonite post 2.3' Southerly of corner.



Page 1 of 2

TILLAMOOK COUNTY SURVEYORS OFFICE
COURT HOUSE, TILLAMOOK OREGON 97141

SECTION CORNER COMMON SECTIONS 9, 10, 15, & 16 T.3S., R.10W., W.M.

New Accessory

*72" light hat section post North 1.5'.

*indicates Tillamook County Surveyors yellow metal location poster attached.

Surveys and Rewitnesses of record

Rewitness Book 6 Page 99	1978	Bureau of Land Management
Book 1 Page 239	6-11-54	Mervin Whitmore U.S.F.S.
Book 6 Page 50	Nov. 1964	Bureau of Land Management
Rewitness Card #603	6-11-54	Mervin Whitmore U.S.F.S.
A-5205	Jan. 1985	Allan E. Duncan LS 793
B-1085	12-24-82	Edgar R. Cook LS 1073 & David K. Bateman LS 1068



Monument Location

This corner is located approximately 25' East of a small creek,
course approximately south, in the NE corner of a recent clear cut.

In the presence of Dan McNutt and Al Dvorak

January 7, 1992

Title:

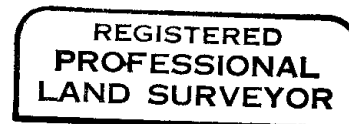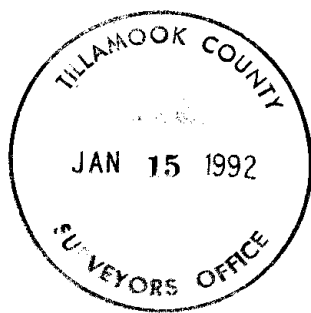

Allan E. Duncan, C.S.

