
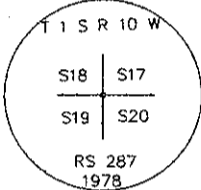


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
Tillamook County Surveyor's Office

<b>SECTION: The Southeast Corner of Section 18</b>	<b>TOWNSHIP 1 South</b>	<b>RANGE 10 West</b>
<b>COUNTY: Tillamook</b>		<b>DATE: 10-26-06</b>
<b>CORNER DESIGNATION:</b> The section corner common to Sections 18, 17, 19 and 20, Township 1 South, Range 10 West, W.M., Tillamook County, Oregon.		<b>(Please check one)</b>
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset
<input type="checkbox"/> Referenced Out		
<b>Previous Rewitnesses, Restorations and Surveys, etc.:</b> Tillamook County Rewitness Card #308.		
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found a 3" diameter brass cap in a 10" diameter tile and concrete stamped as shown hereon. Found a partially rotted 4" x 4" x 60" wooden post North 1.5'. Also found a 3/4" iron pipe lying on the ground north of the corner monument. Found a 30" diameter stump and a 10' high 48" diameter snag as described on Rewitness Card #308.		
<b>Monument Set (Procedures and Description):</b> N/A	<b>Sketch of Found Monument:</b> 	
<b>Other new accessories set:</b> Set a 72" Hat Section post with yellow metal location tag South 3.0' from the corner monument.		
<b>New Bearing Trees:</b> *A 13" diameter Hemlock tree scribed "T1SR10WS18BT" with a brass washer stamped "TC SURV" and nail set between the 'B & T' which bears North 9° West 8.5'. *A 15" diameter Spruce tree scribed "T1SR10WS17BT" with a brass washer stamped "TC SURV" and nail set between the 'B & T' which bears North 78° East 21.8'. *A 13" diameter Spruce tree scribed "T1SR10WS20BT" with a brass washer stamped "TC SURV" and nail set between the 'B & T' which bears South 68° East 16.95'. *A 6" diameter Hemlock tree scribed "T1SR10WS19BT" with a brass washer stamped "TC SURV" and nail set between the 'B & T' which bears South 10° West 18.25'. * INDICATES TILLAMOOK COUNTY YELLOW METAL LOCATION POSTER TAG ATTACHED.		
<b>Location &amp; Comments:</b> This corner is located approximately 200' East and 100' North of the end of an old logging road.		
<b>Firm / Agency</b> <b>Address:</b> TILLAMOOK COUNTY SURVEYOR'S OFFICE		<b>SURVEYOR'S SEAL</b>  
<b>Party Chief:</b> Joe Jensen, PLS 60067, Survey Supervisor		
<b>Notes:</b>		
<b>Witness:</b> Danny R. McNutt, PLS 49230, Tillamook County Surveyor		

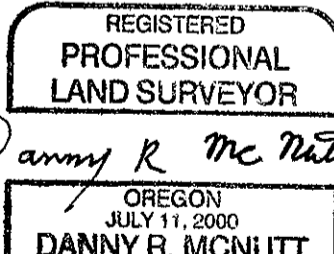