
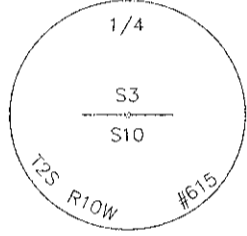


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 3, 10	TOWNSHIP 2 South	RANGE 10 West
COUNTY: Tillamook		DATE: 11-13-08
CORNER DESIGNATION: The historical position of the quarter corner common to Sections 3 and 10 as set by Roswell K. Miller, L.S. 615.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
<input type="checkbox"/> Referenced Out		
Previous Rewitnesses, Restorations and Surveys, etc: GLO Pg. 6, 2S 10W 1857, Quarter corner set from original SW Bearing Tree by L.S. 615 in Re-witness Book 2, Page 548.		
Found Monument(s) and Accessories (Condition & Source): Found a 3" diameter Brass Cap in good condition, 1.0' above ground. Rotated Cap North. The monument is stamped as shown hereon. (G.L.O.) – Did not find the 96" diameter spruce at record position. (G.L.O.) – Did not find the 40" diameter Hemlock at record position. (Bk. 2, Pg. 548) – Found 72" diameter, Spruce stump with a nail in the face, scribing visible, at N 31° W 54.2' (54.6) Feet. (Bk. 2, Pg. 548) – Found badly rotted stump at the record position of the 30" Hemlock. (Bk. 2, Pg. 548) – Did not find the 30" diameter Hemlock at record position.		
Monument Set (Procedures and Description): Not applicable.	Sketch of Found Monument: 	
New accessories set: Set a 72" hat section post with yellow metal location tag 3.0 feet northwesterly from corner position. Placed the found, badly rotten 6" X 6" White Cedar Post next to the corner position. Set 120 lbs. of concrete in a 12" diameter plastic cylinder around corner.		
New Bearing Trees set: 37" diameter Spruce bears N 73° W 31.0 Feet, Scribed "T2S R10W 1/4 S3 BT", Tagged, Painted. 15" diameter Hemlock bears S 55° W 16.7 Feet, Scribed "T2S R10W 1/4 S10 BT", Tagged and Painted. All new bearing trees have a nail and washer marked, "Till. Co. Surveyor", in face of blaze.		
Location & Comments: The purpose of this re-witness is to perpetuate the historical position of the monument set by L.S. #615.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL  RENEWAL 12 - 31 - 2008
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor		
Notes:		
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor. Michael R. Rice, L.S.I. 16723, Survey Technician		

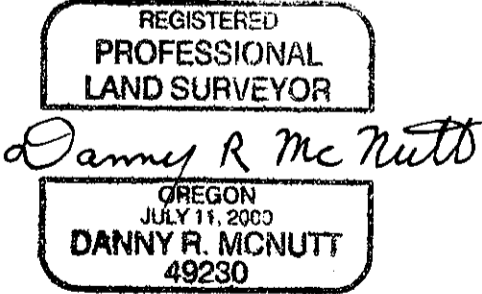