
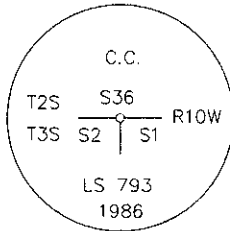


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: NW Corner of Section 1	TOWNSHIP 3 South	RANGE 10 West
COUNTY: Tillamook		DATE: 01-15-09
CORNER DESIGNATION: The Section Corner common to Sections 1 and 2, T. 3 S., R. 10 W., and the Closing Corner to Section 36, T. 2 S., R. 10 W., W.M.	(Please check one)	
	<input type="checkbox"/>	Condition Report Only
	<input type="checkbox"/>	Restoration
	<input checked="" type="checkbox"/>	Rewitness
	<input type="checkbox"/>	Unrecorded
	<input type="checkbox"/>	Reset
Previous Rewitnesses, Restorations and Surveys, etc.: B.L.M Field Notes Volume: OR-R0272 Page: 0121 (G.L.O. 3S10 Page 16, 1882), Book 2 Page 463, Rewitness #567, B-738, B-69, Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found 3" brass cap in good condition, in cement, cap is not rotated north. The monument is stamped as shown hereon. Tied the monument conventionally with a total station using GPS established control. Oregon North Zone State Plane in NAD 83/91 coordinate for the monument is N = 630818.916, E = 7337513.867. (Book 2, Page 463) – Found 15" Diameter Stump, 6' Tall, bears S 55 1/4° E 10.9'. (Book 2, Page 463) – Found 19" Diameter Stump, 7' Tall, bears S 6 1/2° W 8.3'. (Rewitness #567) – Found 72" Hat Section Post 1.5' North of monument and rescribed metal location tag.		
Monument Set (Procedures and Description): Not Applicable.	Sketch of Found Monument: 	
Other new accessories set: Set a R.R. Spike, center punched, on the north edge of gravel logging road, used for occupy point to tie the Closing Corner Monument. The Oregon North Zone State Plane NAD 83/91 coordinate for said point is N = 630789.959, E = 7337518.715. Set a 5/8" Iron Rod with a R.P.C. marked, "Tillamook Co. Survey", as a backsight point, said point is on the south side of the logging road, said point has an Oregon North Zone State Plane NAD 83/91 coordinate of N = 631052.975, E = 7336917.522. The conventionally tied angle right from said setup to monument is 56°52'00" with a horizontal distance of 29.36'. R.P.C. indicates "Red Plastic Cap"		
New Bearing Trees: * 5" diameter Hemlock bears N 11° E 16.1', scribed "T2S BT", tagged and painted. * 8" diameter Hemlock bears East 13.3', scribed "T3S R10W S1 BT", tagged and painted. All new Bearing Trees have a nail and aluminum washer marked, "Till. Co. Surveyor" in the face of scribe between the B and T. *Indicates yellow Tillamook County Corner tag affixed.		
Location & Comments: This corner is located approximately 30' north of Yellow Fir mainline logging road and at the intersection with a south running spur road.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE		SURVEYOR'S SEAL
Party Chief: Joe Jensen, PLS 60067, Survey Supervisor		
Notes: This is a rewitness of the original Closing Corner. The Closing Corner is on-line between Sections 1 and 2, T. 3 S., R. 10 W., and is held for bearing only between said sections.		
Witness: Danny R. McNutt, PLS 49230, Tillamook County Surveyor Michael R. Rice, LSI 16723, Survey Technician		

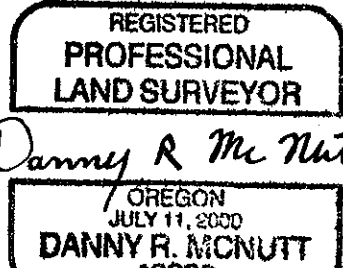