
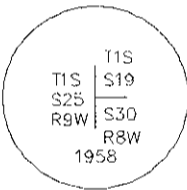


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
Tillamook County Surveyor's Office

<b>SECTION:</b> SW Corner 19	<b>TOWNSHIP</b> 1 South	<b>RANGE</b> 8 West
<b>COUNTY:</b> Tillamook		<b>DATE:</b> 2-17-09
<b>CORNER DESIGNATION:</b> The Section Corner Common to Sections 19 and 30, T. 1 S., R. 8 W., W.M.		<b>(Please check one)</b>
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
<b>Previous Rewitnesses, Restorations and Surveys, etc:</b> BLM Field Notes Volume: OR-R0267 Page 261 (GLO 1S8 Pg. 19) (1883), Book 3, Page 110-111 (1958), Map B-530 (1967), Map A-3360 (1977) BLM Field Notes Volume: OR-R0647 Page 312 (1989) and Map B-1524 (1990) Tillamook County Survey Records.		<input type="checkbox"/> Reset at surface
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found a 3 1/4" brass cap up 1.0' in good condition. The monument is stamped as shown hereon. Found Original (1883) Basalt Stone 16" X 10" X 8", buried, with 4 notches on the north side and 2 notches on the south side. Original 1883 BT's are gone. (G.L.O. 1884 Resurvey) – Found Hemlock rotted shell (was 15"), bears (S 46° E 36 lks.). (G.L.O. 1884 Resurvey) – Found Spruce rotted stub (was 28"), 3' tall, bears (S 13 1/4° W 16 1/2 lks.). (G.L.O. 1884 Resurvey) – Found Spruce rotted stub (was 37"), 4' tall, bears (N 30° W 45 lks.). (G.L.O. 1884 Resurvey) – Found Spruce uproot (was 35"), bears (N 10° W 20 lks.). (Book 3, Page 111) – Found 22" Hemlock snag (was 16"), 20' tall, bears (N 66 1/2° E 43 lks.). (Book 3, Page 111) – Found 21" Fir snag (was 20"), 40' tall, bears (S 46° E 28 lks.). (B.L.M.) – Found 8" diameter Spruce (was 4"), with a B.L.M. tag, bears (N 52 1/2° E 7 1/2 lks.). ( ) Indicates record information, Tillamook County Survey Records.		<input type="checkbox"/> Referenced Out
<b>Monument Set (Procedures and Description):</b> Not applicable.	<b>Sketch of Found Monument:</b>  	
<b>New accessories set:</b> Placed the found stone on the North side of brass cap monument and set a rock collar. Set 120 lbs. of concrete in a 12" diameter cylinder around monument. Set a 72" hat section post with a yellow metal location poster, North 3.0' from monument.		
<b>New Bearing Trees set:</b> 16" diameter Spruce bears N 5° 30' W 4.9', scribed, "T1S R9W BT CS", tagged and painted. 16" diameter Hemlock bears S 52° E 18.4', scribed, "T1S R8W S30 BT", tagged and painted. All new bearing trees have a nail and aluminum washer marked, "Till. Co. Surveyor", in face of blaze, between the scribed B and T, and a yellow metal location tag affixed.		
<b>Location &amp; Comments:</b> Corner is located on a ridge bearing N 30° E and S 30° W.		<b>SURVEYOR'S SEAL</b>  <div style="border: 2px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> <b>REGISTERED PROFESSIONAL LAND SURVEYOR</b> </div>  <div style="border: 2px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> <b>OREGON JANUARY 10, 2006 JOSEPH V. JENSEN 60067</b> </div> <b>RENEWAL DATE: 06-30-09</b>
<b>Firm / Agency</b> <b>Address:</b> TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		
<b>Party Chief:</b> Joe Jensen, P.L.S. 60067, Survey Supervisor		
<b>Notes:</b>		
<b>Witnesses:</b> Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician		

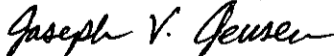