
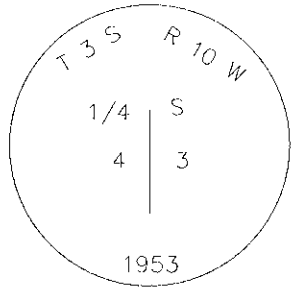


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 4	TOWNSHIP 3 South	RANGE 10 West
COUNTY: Tillamook		DATE: 4-06-09
CORNER DESIGNATION: The Quarter Corner common to Section 4 and Section 3.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
		<input type="checkbox"/> Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0545 Page 132 (1933) same as Book 3 Page 201, Rewitness Card #585 (1976), Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found an unrecorded babbitt cap upright and in good condition. The monument is stamped as shown hereon. Found a leaning and badly bent fence post with yellow U.S. government tag southeasterly of monument. (1933 G.L.O.) – Did not find the 16" diameter Hemlock. (1933 G.L.O.) – Found rotten Spruce stump (was 50"), no marks visible, at record position. (Rewitness #585) – Found 22" diameter Hemlock stump (was 18"), with healed face, 5' tall with yellow metal location tag still affixed, at record position. (Rewitness #585) – Found 26" diameter Hemlock stump (was 22"), with healed face, 5' tall, at record position. () Indicates record information from Tillamook County Survey Records.		
Monument Set (Procedures and Description): Not applicable.	Sketch of Found Monument: 	
New accessories set: Placed 120 lbs. of concrete in a 12" diameter cylinder around found monument. Straightened and reset found bent fencepost with yellow U.S. Government tag South 46° East 1.2 feet.		
New Bearing Trees set: *9" diameter Douglas Fir tree bears N 65° E 3.15', scribed "1/4 S3 BT", tagged and painted. *10" diameter Douglas Fir tree bears N 70° W 8.3', scribed "1/4 S4 BT", tagged and painted * Indicates yellow metal location tag affixed to new bearing tree. All new bearing trees have a nail and aluminum washer marked, "Till. Co. Surveyor", in face of blaze, between the scribed B and T.		
Location & Comments: Corner is located approximately 250' East of logging road number 310B on a steep Easterly facing slope.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL 
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor		
Notes:		
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor.		

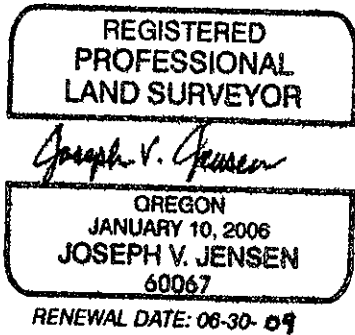