
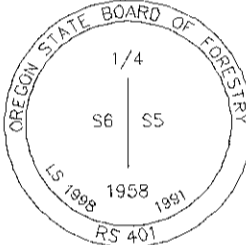


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 5 and 6	TOWNSHIP 2 South	RANGE 7 West
COUNTY: Tillamook		DATE: 7-30-09
CORNER DESIGNATION: The Quarter Corner common to Sections 5 and 6.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
<input type="checkbox"/> Referenced Out		
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0345 Page 343 (GLO 2S7 Pages 60-61) (1891), Rewitness Book 1 Page 347 (1958), Rewitness Book 7 Page 92 (1991), Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found a 3" dia. O.S.B.F. Brass Cap, flush, good condition. The monument was set in Rewitness Book 1, Page 347 (1958). The monument is stamped as shown hereon. Found a white painted cedar post lying next to the monument. (G.L.O.) – Found rotten remains (was 5" dia Fir bears N 6° E 22 lks. [14.52']). (G.L.O.) – Did not find the (5" dia. Vine Maple bears S 52 1/2° W 18 lks. [11.88']). (Book 1, Page 347) – Found (53" Fir Stump), badly rotten bears (S 10° W 170.3') no marks visible. (Book 7, Page 92) – Found 19" dia. (was 14") Fir bears (N 77° W 28.9') healed scar and tag. (Book 7, Page 92) – Found 19" dia. (was 16") Fir bears (S 14 1/2° E 23.8') healed scar and tag. () Indicates record information, Tillamook County Survey Records. [] Indicates converted value from links to feet.		
Monument Set (Procedures and Description): Not applicable.	Sketch of Found Monument: 	
New accessories set: Set 120 lbs. of concrete in a 12" dia. cylinder around monument. Set a 72" hat section post with a yellow metal location tag, North 3.0' from monument.		
New Bearing Trees set: * 11" dia. Fir bears N 38° W 7.6', scribed "T2S R7W 1/4 S6 BT", tagged and painted. * 18" dia. Fir bears S 54° E 4.9', scribed "T2S R7W 1/4 S5 BT", tagged and painted. * Indicates a yellow metal location tag affixed, also indicates a nail and aluminum washer marked, "Till. Co. Surveyor" in the face of the blaze between the scribed "B" and "T".		
Location & Comments: Corner is located approx. 400' South of Toll Road.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor		<div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> REGISTERED PROFESSIONAL LAND SURVEYOR </div>
Notes: Digital images were taken of the monument, the found bearing trees and the new bearing trees.		
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician		<div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067 </div>
RENEWAL DATE: 06-30-2011		

