
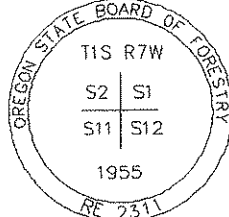


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: SW Corner of 1	TOWNSHIP 1 South	RANGE 7 West	
COUNTY: Tillamook		DATE: 8-27-09	
CORNER DESIGNATION: The Section Corner common to Sections 1, 2, 11 and 12, T. 1 S. R. 7 W.		(Please check one)	
		<input type="checkbox"/>	Condition Report Only
		<input type="checkbox"/>	Restoration
		<input checked="" type="checkbox"/>	Rewitness
		<input type="checkbox"/>	Unrecorded
		<input type="checkbox"/>	Reset at surface
		<input type="checkbox"/>	Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0345 Pages 80-81, (GLO Book 1S7 Page 31) (1891), Tillamook County Survey Records; Rewitness Book 1, Page 255 (1955), Tillamook County Survey Records.			
Found Monument(s) and Accessories (Condition & Source): Found a 3" O.S.B.F. Brass Cap, good condition, protruding 1.0', with a rock collar. The monument was set in Rewitness Book 1, Page 255 (1955). The monument is stamped as shown hereon. (G.L.O.) – Did not find the (16" dia. Hemlock bears N 63° E 28 lks. [18.48']). (G.L.O.) – Found 37" dia. (was 30") Fir Stump, 3' tall, bears (S 71 1/2° E 91 lks. [60.06']) scribing "BT" visible. (G.L.O.) – Found rotten stump (was 40" Hemlock), 3' tall, bears (S 14° W 58 lks. [38.28']). (G.L.O.) – Did not find the (6" dia. Hemlock bears N 40 1/2° W 66 lks. [43.56']). (Book 1, Page 255) – Found 40" dia. Fir Stump, 4' tall, (bears N 2° W 29.5'), scribing partially visible. (Book 1, Page 255) – Found rotten 60" Fir Stump, 3' tall, (bears N 53° E 40.0'), no marks visible. (Book 1, Page 255) – Found 34" dia. Fir Stump, 5' tall, (bears S 58° W 4.5'), scribing visible. (Book 1, Page 255) – Found rotten 36" dia. Fir Stump, 3' tall, (bears S 20° E 39.6'), scribing partially visible. (Book 1, Page 255) – Found 4" X 4" white painted Cedar post (2' SE of pipe) (Book 1, Page 255) – Did not find the (4" X 4" white painted Cedar post approx. 230' E. on W. edge of Hembre Ridge Road). () Indicates record information, Tillamook County Survey Records. [] Indicates converted value from links to feet.			
Monument Set (Procedures and Description): Not applicable.	Sketch of Found Monument: 		
New accessories set: Set 120 lbs. of concrete in a 12" dia. cylinder around monument. Set 72" hat section post with a yellow metal location tag, 3.0' East from monument. Reset 4" X 4" white painted Cedar post 1.0' North of monument.			
New Bearing Trees set: *13" dia. Douglas Fir bears N 52° W 10.6', scribed "T1S R7W S2 BT", tagged and painted. *13" dia. Douglas Fir bears N 33° E 18.5', scribed "T1S R7W S1 BT", tagged and painted. *12" dia. Douglas Fir bears S 75° E 9.2', scribed "T1S R7W S12 BT", tagged and painted. *9" dia. Douglas Fir bears S 9° W 17.6', scribed "T1S R7W S11 BT", tagged and painted. *Indicates an aluminum nail with washer marked, "Till. Co. Surveyor" in the face between the scribed "B" and "T" and a yellow metal location tag attached to the bearing tree.			
Location & Comments: Monument is located approximately 230' West of Hembre Ridge Road, on a steep hillside.			
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL	
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor			
Notes: Digital images were taken of the monument, the found bearing trees and the new accessories.		RENEWAL DATE: 08-30-2011	
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician			

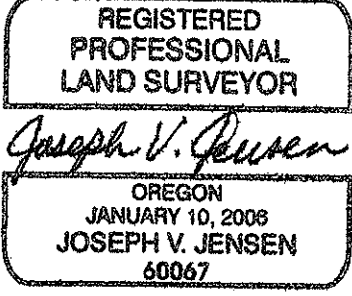