
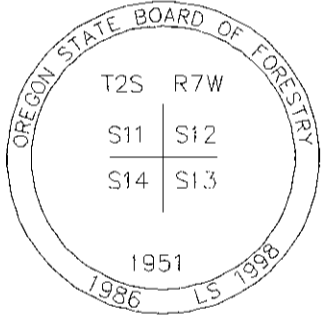


**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
**Tillamook County Surveyor's Office**

<b>SECTION: SE COR 11</b>	<b>TOWNSHIP 2 South</b>	<b>RANGE 7 West</b>
<b>COUNTY: Tillamook</b>		<b>DATE: 2-25-10</b>
<b>CORNER DESIGNATION:</b> The Section Corner common to Sections 11, 12, 13 and 14, T. 2 S., R. 7 W., W.M.		<b>(Please check one)</b>
		<input checked="" type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
<b>Previous Rewitnesses, Restorations and Surveys, etc:</b> BLM Field Notes Volume: OR-R0345 Page 237 - 238, (GLO Book 2S7 Page 8) (1891), Tillamook County Survey Records; Rewitness Book 2, Page 97 (1951), Rewitness Book 6, Page 288 (1986), Tillamook County Survey Records.		
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Found a 3" O.S.B.F. Brass Cap, good condition, flush, with a rock collar. The monument was set in Rewitness Book 2, Page 97 (1951). The monument is stamped as shown hereon. The original post is missing. (G.L.O.) – Did not find the (18" Hemlock bears S 41° E 28 lks. [18.48']). (G.L.O.) – Did not find the (20" Hemlock bears N 15 1/2° W 40 lks. [26.4']). (G.L.O.) – Did not find the (13" Hemlock bears N 35 1/4° E 36 lks. [23.76']). (G.L.O.) – Found badly rotten Hemlock stump (was 24"), bears (S 52° W 26 lks. [17.16]), no visible marks. (Book 2, Page 97) – Found badly decayed Fir stump (was 48"), bears (N 79° W 34.8'), no visible marks. (Book 2, Page 97) – Found (44" Fir stump), 3.5' tall, bears (S 31 1/2° E 19.8'), scribing visible. (Book 2, Page 97) – Found (48" Fir stump), 5' tall, bears (N 80 1/2° E 67.3'), scribing visible. (Book 6, Page 288) – Found 20" Fir (was 13"), bears N 17° W (N 13 1/4° W) (23.1'), healed scar and tag. (Book 6, Page 288) – Found 22" Fir (was 14"), bears N 41° E (N 44 3/4° E) (25.7'), healed scar and tag. (Book 6, Page 288) – Found 33" Fir (was 19"), bears S 76° W (S 89 1/4° W) (7.5'), healed scar and tag. ( ) Indicates record information, Tillamook County Survey Records. [ ] Indicates converted value from links to feet.		
<b>Monument Set (Procedures and Description):</b> Not applicable.	<b>Sketch of Found Monument:</b> 	
<b>New accessories set:</b> Set 120 lbs. of concrete in a 12" dia. cylinder around the monument. Set 72" hat section post with a yellow metal location tag North 3.0' from the monument.		
<b>New Bearing Trees set:</b> 17" D. Fir bears N 55° W 23.8', scribed "T2S R7W S13 BT" with an aluminum nail and washer marked "Till. Co. Surveyor" between the scribed "B" and "T" and a yellow metal location tag.		
<b>Location &amp; Comments:</b> Monument is located approximately 200' East of Murphy Grade Road.		
<b>Firm / Agency</b> <b>Address:</b> TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		<b>SURVEYOR'S SEAL</b>
<b>Party Chief:</b> Joe Jensen, P.L.S. 60067, Survey Supervisor		 RENEWAL DATE: 08-30-2011
<b>Notes:</b> Digital images were taken of the monument and the found bearing trees.		
<b>Witnesses:</b> Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician		

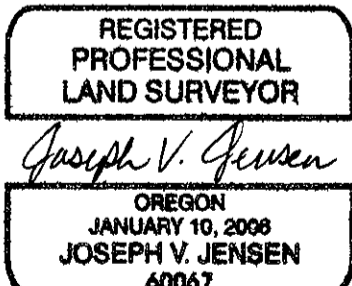