


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: East 1/4 corner of Section 14	TOWNSHIP 2 South	RANGE 10 West
COUNTY: Tillamook		DATE: 11-05-10
CORNER DESIGNATION: The Reference monument for the East one-quarter corner of Section 14, T. 2 S., R. 10 W., W.M.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset
		<input type="checkbox"/> Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc.: B.L.M. Field Notes Volume: OR-R0272 Page: 0068, (G.L.O. 2S10 Page 33, 1882); Rewitness Book 1, Page 99; Rewitness Book 4, Page 93; Survey Book S3, Page 238; Rewitness Card #458, B-317, Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found 3" Tillamook County Surveyor brass cap in concrete. The monument is stamped as shown hereon. (G.L.O.) – Found a very rotted out shell of a +/- 40" diameter X 4' tall Hemlock stump, no scribe marks, for corner monument. (was an 18" Hemlock tree marked "1/4 S" on West face.) Both of the original bearing trees to the 1/4 corner position are now gone. (Rewitness Card #458) – Found a 4' tall X 4" diameter rotten Hemlock stub with visible scribe marks "CS1/4S" (was a 12" diameter Hemlock tree S 86° W 12.0'). (Rewitness Card #458) – Found a rotten 3' tall X 24" diameter Hemlock stump with the bottom of a face visible (was a 24" diameter Hemlock tree S 29° E 14.4').		
Monument Set (Procedures and Description): Not Applicable.	Sketch of Found Reference Monument: 	
Other new accessories set:		
New Bearing Trees For Reference Monument: *14" dia. Hemlock tree bears N 72-1/2° E 10.4', scribed "1/4RMBT", tagged and painted. *11" dia. Hemlock tree bears S 07° W 16.0', scribed "1/4RMBT", tagged and painted. *15" dia. Hemlock tree bears S 30° E 16.4', scribed "1/4RMBT", tagged and painted. Note: All new bearing trees have a nail and aluminum washer marked, "Till. Co. Surveyor" in face between B and T. * Indicates a yellow metal location tag attached.		
Location & Comments: This corner is located approximately 150' Easterly of an existing logging road. Yellow plastic monument tags marked "PLEASE PROTECT NEARBY SURVEY MARKER" were placed on trees surrounding the monument location.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE		SURVEYOR'S SEAL
Party Chief: Joe Jensen, PLS 60067, Survey Supervisor		REGISTERED PROFESSIONAL LAND SURVEYOR
Notes: Digital images were taken of the monument and the new accessories.		<i>Joseph V. Jensen</i>
Witness: Danny R. McNutt, PLS 49230, Tillamook County Surveyor Michael R. Rice, LSI 16723, Survey Technician		OREGON JANUARY 10, 2006 JOSEPH V. JENSEN 60067

RENEWAL DATE: 06-30-2011

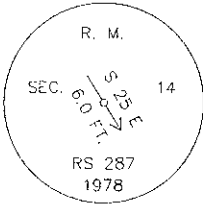