

OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: SE Sec 32	TOWNSHIP 2 South	RANGE 7 West
---------------------------	-------------------------	---------------------

COUNTY: Tillamook	DATE: 1-24-11
--------------------------	----------------------

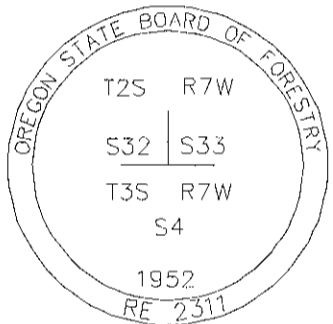
CORNER DESIGNATION: The Closing Corner common to Sections 32 and 33, T. 2 S., R. 7 W., W.M.	<p align="center">(Please check one)</p> <input type="checkbox"/> Condition Report Only <input type="checkbox"/> Restoration <input checked="" type="checkbox"/> Rewitness <input type="checkbox"/> Unrecorded <input type="checkbox"/> Reset at surface <input type="checkbox"/> Referenced Out
--	--

Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0345 Pages 38 - 39, (GLO Book 3S7 Page 22) (1891), Rewitness Book 2 Page 176 (1952), Rewitness Book 7 Page 174 (1993), Tillamook County Survey Records.

Found Monument(s) and Accessories (Condition & Source): Found a 3" diameter O.S.B.F. Brass Cap, on a hillside, flush and good condition, as restored in Book 2, Page 176 (1952). Monument is stamped as shown hereon. Hat section post has been smashed flat.

(G.L.O.) – Did not find the (3" Vine Maple bears N 56° W 16 lks. [10.56']).
 (G.L.O.) – Did not find the (15" Hemlock bears N 55° E 15 lks. [9.9']).
 (G.L.O.) – Did not find the (5" Hemlock bears S 34°30' E 20 lks. [13.2']).
 (G.L.O.) – Found 60" Fir Stump, (was 40"), 8' tall, (bears S 58° W 50 lks. [33']), scribing partially visible.
 (Book 2, Page 176) – Found 42" Fir Stump, 8' tall, (bears N 2° E 19.6'), scribing partially visible.
 (Book 2, Page 176) – Found rotten Fir Stump, (was 42"), 10' tall, (bears N 73° W 42.9').
 (Book 2, Page 176) – Found 60" Fir Stump, 6' tall, (bears S 66° E 37.0'), scribing visible and a yellow metal location tag affixed.
 (Book 7, Page 174) – Did not find the (11" Fir bears N 52° W 9.01').
 (Book 7, Page 174) – Found 16" Fir, (was 9"), (bears N 32° E 13.88'), healed face and a yellow metal location tag affixed.

() Indicates record information, Tillamook County Survey Records.
 [] Indicates converted value from links to feet.

Monument Set (Procedures and Description): N/A	Sketch of Found Monument: 
---	---

New Accessories set: Set 72" hat section post with a yellow metal location tag North 3.0' from the monument. Set 120 lbs. of concrete in a 12" dia. cylinder around monument.

New Bearing Trees Marked:
 * 18" diameter Fir bears N 43° W 44.9', scribed "T2SR7WS32BT", yellow metal location tag affixed and tree painted.
 * Indicates an aluminum nail with a washer stamped "Till. Co. Surveyor" is set in the face between the scribed "B" and "T".

Location & Comments: Monument is located approximately 0.7 miles Southwesterly of the intersection of East Fork Bypass and Miller Road, 125' Southerly of the center of Miller Road.

Firm / Agency
Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE
 201 Laurel Avenue
 Tillamook, Oregon 97141

Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor

Notes: Digital images were taken of the monument and its accessories.

Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor
 Michael R. Rice, L.S.I. 16723, Survey Technician

SURVEYOR'S SEAL

REGISTERED
 PROFESSIONAL
 LAND SURVEYOR

Joseph V. Jensen

OREGON
 JANUARY 10, 2008
 JOSEPH V. JENSEN
 60067

RENEWAL DATE: 06-30-

