
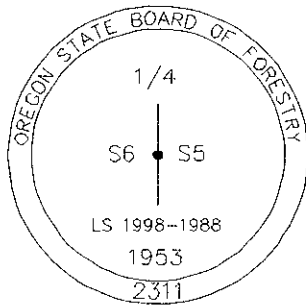


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 5	TOWNSHIP 3 South	RANGE 7 West
COUNTY: Tillamook		DATE: 1-25-11
CORNER DESIGNATION: The Quarter Corner common to Sections 5 and 6, T. 3 S., R. 7 W., W.M.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
		<input type="checkbox"/> Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0378 Pages 346 - 347, (GLO Book 3S7 Page 75) (1894), Rewitness Book 2 Page 315 (1953), Rewitness Book 6 Page 362 (1988), BLM Field Notes Volume: OR-R0682 Pages 52 - 53 (2003), Map B-3037 (2006), Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found a 3" diameter O.S.B.F. Brass Cap, flush, in a rock mound as restored in Book 2, Page 315 (1953). Monument is stamped as shown hereon. Found a 4" X 4" Wood Post 0.9' Northeasterly with a yellow metal location tag. Found carsonite post lying down. (G.L.O.) - Did not find the (12" Hemlock bears N 20° E 40 lks. [26.4']). (G.L.O.) - Did not find the (10" Hemlock bears N 63° W 12 lks. [7.92']). (Book 2, Page 315) - Found 31" Fir Stump (was 16" snag), 4' tall, bears (S 85° W 29.5'), top of face visible. (Book 2, Page 315) - Found 42" Fir Stump (was 42" snag), bears (N 71° E 58.2'), scribing "1/4 S5 BT RE2311" visible, tags. (Book 6, Page 362) - Found 30" Fir (was 19"), bears (N 25° W 19.4'), healed face and yellow metal location tag. (Book 6, Page 362) - Found 22" Fir (was 10"), bears (N 20° E 35.1'), healed face and yellow metal location tag. () Indicates record information, Tillamook County Survey Records. [] Indicates converted value from links to feet.		
Monument Set (Procedures and Description): N/A	Sketch of Found Monument: 	
New Accessories set: Set 120 lbs. of concrete in a 12" dia. cylinder around monument. Re-set rock collar. Set 72" hat section post 3.0' South of the monument. Re-set carsonite post 3.0' East of the monument.		
New Bearing Trees Marked: * 21" D. Fir bears S 9° E 13.6', scribed "T3S R7W S5 BT", tagged and painted. * Indicates an aluminum nail with a washer stamped "Till. Co. Surveyor" is set in the face between the scribed "B" and "T".		
Location & Comments: Monument is located approx. 200' Northerly of a spur logging road on a gentle, unremarkable, southeasterly slope.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141		SURVEYOR'S SEAL
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor		<div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> REGISTERED PROFESSIONAL LAND SURVEYOR </div>
Notes: Digital images were taken of the monument and its accessories.		
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician		<div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> OREGON JANUARY 10, 2006 JOSEPH V. JENSEN 60067 </div>
		RENEWAL DATE: 06-30-2011

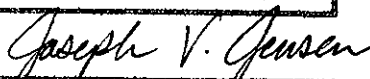