
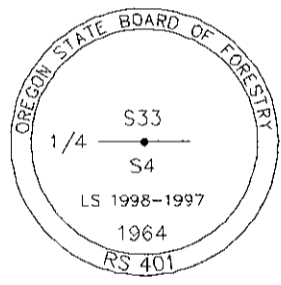


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 4	TOWNSHIP 3 North	RANGE 9 West
COUNTY: Tillamook		DATE: 6-9-11
CORNER DESIGNATION: The Quarter Corner common to Section 4, T. 3 N., R. 9 W., W.M. and Section 33, T. 4 N., R. 9 W., W.M.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
		<input type="checkbox"/> Referenced Out
<p>Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0259 Page 75, (GLO Book 3N9 Page 14) 1882, (Map A-8382) [CS# 760] 1964, (Map B-510) [CS# 777] 1966, (Map B-1212) [CS# 8273] 1986, (Rewitness Book 7 Page 247) [CS# BT-1566] 1997, (Map B-3453) [CS# 12455] 2008. () Indicates Tillamook County Survey Records. [] Indicates corresponding Clatsop County Survey Records.</p>		
<p>Found Monument(s) and Accessories (Condition & Source): Found a 3" diameter O.S.B.F. Brass Cap rotated Northeasterly, flush and in position. Corner was reestablished on map A-8382 (1964). Monument is stamped as shown hereon. Found an orange carsonite post 1.7' Northwesterly and a white painted cedar post 1.0' Easterly from the monument. (G.L.O.) – Did not find the (12" Hemlock bears N 25° E 15 lks. [9.9']). (G.L.O.) – Did not find the (8" Hemlock bears S 40° E 26 lks. [17.16']). (Map A-8382) – Did not find the (18" Hemlock bears N 32 3/4° W 40.7'). (Map A-8382) – Did not find the (17" Hemlock bears S 57 1/2° W 29.4'). (Book 7, Page 247) – Found (40" Spruce) now a stump, 4' tall, (bears N 32 1/4° E) 59.5' (59.9'), scribes partially visible, tag. (Book 7, Page 247) – Found 14" Hemlock, (was 10"), (bears S 2° E) 18.9' to face (19.2'), healed face and yellow tag. (Book 7, Page 247) – Found 26" Fir, (was 23"), (bears S 82 1/4° W 35.0'), healed face and yellow metal location tag. (Book 7, Page 247) – Found 30" Hemlock, (was 26"), 5' tall stump, bears N 28 1/2° W 70.3' (N 27 1/2° W 70.8'), healed and tag. () Indicates record information, Tillamook County Survey Records (see above for Clatsop County Recorded Numbers). [] Indicates converted value from links to feet.</p>		
<p>Monument Tied (Procedures and Description): I set 2 railroad spikes, as random control, 404.55' apart in an open area on the westerly edge of County Line Road. I then single occupied the GPS established control. I ran an approximately 800' long traverse to tie the monument, eventually closing into a previously obtained GPS control point. The Oregon North Zone State Plane Coordinate in NAD 83/91 for the monument is N = 788812.127, E = 7362505.239 U.S. Survey Foot definition.</p> <p>Latitude = 45°47'00.10793" N Longitude = 123°47'30.47907" W</p>	<p>Sketch of Found Monument:</p> 	
<p>New Accessories set: Set 120 lbs. of concrete in a Cast Iron Collar around monument.</p>		
<p>New Bearing Trees Marked: N/A</p>		
<p>Location & Comments: Monument is located approx. 50' Easterly of a County Line Road.</p>		
<p>Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141</p>		<p>SURVEYOR'S SEAL</p>
<p>Party Chief: Joe Jensen, P.L.S. 60067, Deputy County Surveyor</p>		<div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> <p align="center">REGISTERED PROFESSIONAL LAND SURVEYOR</p> </div>
<p>Notes: Digital images were taken of the monument and its accessories. Accessories were tied with a Topcon GPT 3005 Total Station.</p>		
<p>Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician</p>		<div style="border: 1px solid black; padding: 5px; width: fit-content; margin: 0 auto;"> <p align="center">OREGON JANUARY 10, 2008 JOSEPH V. JENSEN 60067</p> </div> <p align="center">RENEWAL DATE: 06-30-2013</p>

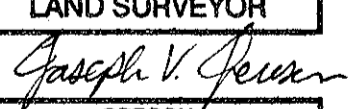