
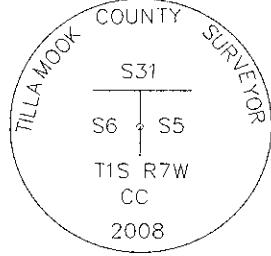


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT  
Tillamook County Surveyor's Office

SECTION: The NE corner of Section 6, T1S, R7W,	TOWNSHIP 1 South	RANGE 7 West
COUNTY: Tillamook		DATE: 07-25-12
CORNER DESIGNATION: The Closing corner common to Sections 5 and 6, Township 1 South, Range 7 West, W.M.	(Please check one)	
	<input checked="" type="checkbox"/>	Condition Report Only
	<input type="checkbox"/>	Restoration
	<input type="checkbox"/>	Rewitness
	<input type="checkbox"/>	Unrecorded
	<input type="checkbox"/>	Reset at surface
		<input checked="" type="checkbox"/> Referenced Out
Previous Rewitnesses, Restorations and Surveys, etc: Rewitness Book 2, Page 179B; Rewitness Book 7, Page 320, Rewitness Book 7, Page 453, Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): Found all of the bearing trees set by Rewitness Book 7, Page 340 at record position with yellow metal location tags on the trees. Found a 2-1/2" diameter Tillamook County Surveyor Aluminum cap in concrete. The monument is set approximately 3" below road surface. Found a 72" hat section post with yellow metal location tag North 80° East 15.6 feet.		
Monument Set (Procedures and Description: This monument will be destroyed by road construction according to the Oregon Department of Forestry. WGS 84 Geodetic position: Latitude = 45° 31' 16.79637" Longitude = 123° 35' 03.31233".	Sketch of Found Monument: 	
New accessories set: Set a 5/8" x 30" rebar with red plastic cap stamped "Tillamook Co Survey" which bears South 25° 40' 51" East 645.12'. Set a 5/8" x 30" rebar with red plastic cap stamped "Tillamook Co Survey" which bears South 01° 19' 43" West 476.20'. Set a 5/8" x 30" rebar with red plastic cap stamped "Tillamook Co Survey" which bears South 11° 46' 49" West 240.94'. Set a 5/8" x 30" rebar with red plastic cap stamped "Tillamook Co Survey" which bears South 13° 08' 37" West 219.36'.		
New Bearing Trees set: No new bearing trees were set.		
Location & Comments: This corner is located in the center of Rogers Road approximately 1/4 mile Northerly of the intersection with Fox Creek Ridge Road.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141	SURVEYOR'S SEAL 	
Party Chief: Joe Jensen, P.L.S. 60067, Survey Supervisor		
Notes:		
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor; Michael R. Rice, L.S.I. 16723, Survey Technician		

Office Use Only

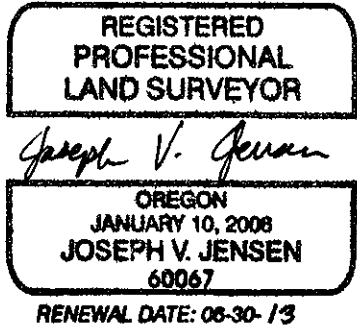