
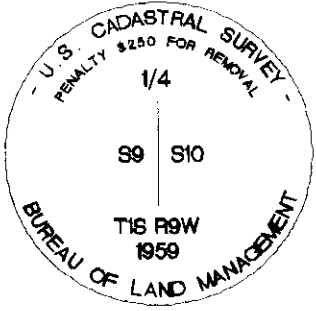


OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT
Tillamook County Surveyor's Office

SECTION: 9 and 10	TOWNSHIP 1 South	RANGE 9 West
COUNTY: Tillamook		DATE: 3-16-12
CORNER DESIGNATION: The Quarter Corner common to Sections 9 and 10, T. 1 S., R. 9 W., W.M.		(Please check one)
		<input type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input checked="" type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
<input type="checkbox"/> Referenced Out		
Previous Rewitnesses, Restorations and Surveys, etc: BLM Field Notes Volume: OR-R0575 Page 227, (1959), same as Rewitness Book 3 Page 149 (1959), Tillamook County Survey Records.		
Found Monument(s) and Accessories (Condition & Source): In 1959, a dependent resurvey of a portion of T. 1 S., R. 9 W., was performed by the Bureau of Land Management where they found no remaining evidence of the original corner or its accessories. They then set a monument at proportionate distance along the section line.		
Found 3" dia. B.L.M. Brass Cap, flush, in good condition. The monument is stamped as shown hereon.		
(BLM) – Found 26" Hemlock, was (14"), bears (N 78° W 23 lks. [15.18']), 14.2' to face, healed scar and yellow metal location tag.		
(BLM) – Found 35" Fir, was (28"), bears (S 61° E 114 1/2 lks. [75.57']), 74.0' to face, healed scar.		
() Indicates record information, Tillamook County Survey Records. [] Indicates record links converted to feet.		
Monument Set (Procedures and Description): N/A	Sketch of Found Monument: 	
New Accessories set: Added a yellow metal location tag to the found BLM BT bearing S 61° E 74.0' to face. Set 120 lbs. of concrete in a 12" dia. cylinder. Set a 72" hat section post with a yellow metal location tag North 3.0' from the monument.		
New Bearing Trees Marked: *20" dia. Spruce bears N 59°30' E 36.5', scribed "T1SR9W1/4S10BT", tagged and painted. *26" dia. Hemlock bears S 26° W 12.5, scribed "T1SR9W1/4S9BT", tagged and painted. * Indicates an aluminum nail with washer marked, "Till. Co. Surveyor" in the face of the blaze between the scribed "B" and "T". Also, a yellow metal location tag affixed in an upper blaze.		
Location & Comments: Monument is located approx. 350' South of the main ridge dividing the Kilchis and Wilson River drainages.		
Firm / Agency Address: TILLAMOOK COUNTY SURVEYOR'S OFFICE 201 Laurel Avenue Tillamook, Oregon 97141	SURVEYOR'S SEAL 	
Party Chief: Joe Jensen, P.L.S. 60067, Deputy County Surveyor		
Notes: Digital images were taken of the monument and its accessories.		
Witnesses: Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor Michael R. Rice, L.S.I. 16723, Survey Technician		

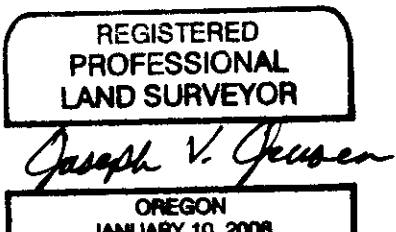