CHAINS

SURVEY FOR THE OREGON STATE BOARD OF FORESTRY

February 28, 1951

Var. 20° E.

Restoration of the corner to sections 17, 18, 19, & 20, Township 1 North, Range 7 West, W.M., Tillamook County, Oregon.

The point for corner determined as described by State Highway notes on file in Tillamook County Surveyors Records.

An iron pipe, li inches in diam.,

from which:

A fir stump, 60 inches in diam., bears N 56° W, a distance of 40.8 feet, scribed: SC BT.

No evidence of a cedar BT.

On the North edge of the 1 inch pipe:

Set a l_{Ξ}^{+} inch iron pipe, 3 feet long, with an Oregon State Board of Forestry bronze cap stamped: TLN R7W S18 S17 S19 S20 1951 199.

Placed a metal location poster on the 60 inch fir stump BT and marked it: Sec 18 TlN R7W Sec Cor 40.8 Ft., S 56° E.

The above work done by Don Davis, Transitman; Richard Morris and Adolf Berglund, Chainmen; under my direction.

February 28, 1951

Var. 20° E.

Restoration of the 4 corner between sections 18 & 19, Township 1 North, Range 7 West, W.M., Tillamook County, Oregon.

The point for corner determined by the remains of the original bearing trees.

A fir snag, 36 inches in diam., bears N 50° W, a distance of 9.9 ft. (15 lks), scribe marks 1/ exposed. (The original field notes call for a bearing of N 25° W).

A fir stub, 28 inches in diam., bears S 44° W, a distance of 27.1 ft. (41 lks), scribe mark S exposed.

At the point for comer:


Set a lt inch iron pipe, 3 feet long, with an Oregon State Board of Forestry bronze cap stamped: \$\frac{1}{4}\$ S18 S19 1951 199.

from which:

A fir snag, 19 inches in diam., bears N 71° 30° W, a distance of 18.0 feet, scribed: $\frac{1}{4}$ S 18 BT 199.

Placed a metal location poster on the 36 inch fir snag BT and marked to Sec 18 TLN R7W & Cor 9.9 Ft. S 250 E.

The above work done by Don Davis, Transitman; Adolf Berglund and Richard Morris, Chainmen; under my direction.

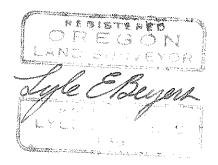

Lyle E. Beyers Forest Engineer

BOOK 2

67-A

CHAINS

SURVEY FOR THE OREGON STATE BOARD OF FORESTRY

February 28, 1951

Var. 22° E.

Restoration of the corner to sections 29, 30, 31, & 32, Township 2 North, Range 6 West, W.M., Tillamook County, Oregon.

The point for corner determined by a cross chizeled on a stone in place 24 x 12 x 12 inches with 5 notches on east edge (did not find the one notch on west edge).

from which:

A fir stump, 34 inches in diam., bears N 05° E, a distance of 10.6 ft. (16 lks), scribe marks 2 N R6W 2 exposed. (The original notes call for a bearing N 50° E).

A fir stump, 40 inches in diam., bears S Ol^o E, a distance of 19.8 ft. (30 lks), scribe marks S 32 exposed.

A fir stump, 25 inches in diam., bears S 56° W, a distance of 17.2 ft. (26 lks), parts of scribe marks exposed.

A fir tree, 36 inches in diam., bears N 27° W, a distance of 37.6 ft. (57 lks), parts of scribe marks exposed on edge of burnt out face. (The original notes call for a bearing of N 33° W).

At a point S 45° E, a distance of 0.9 feet from the chizeled cross on the stone:

Set a $l\frac{1}{2}$ inch iron pipe, 3 feet long, with an Oregon State Board of Forestry bronze cap stamped: T2N R6W S29 S30 S31 S32 1951 199.

from which:

A fir tree, 22 inches in diam., bears N 49° W, a distance of 35.5 feet, scribed: T2N R6W S30 199 BT.

Placed a metal location poster on the 34 inch fir stump BT marked: Sec. 29 T2N R6W Sec Cor 9.5 Ft. S 05° W.

Placed a mound of stone 1 foot high, 3 feet in diam., around the base.

The above work done by Don Davis, Transitman; Richard Morris and Adolf Berglund, Chainmen; under my direction.

REGISTERED OREGON LAND SURVEYOR JANUARY 10. 417 LYLE E. BEYERS 199 Lyle E. Beyers Forest Engineer