## County Surveyor's Record Tillamook County Oregon

### CERTIFIED RECORD OF LAND CORNER MONUMENTATION

#### History of original corner establishment:

Corner established in 1872 by General Land Office (Contract Survey)

<u> </u>	DIAGRAM						
Т	4	S,	R l	0	W	WM.	
	S	3 <b>2</b>	S	3.	3		
	S	5	S	-	4		
Т	5	S, 1	R l	0	W	W.M.	

Old 1872 Bearing Trees are:

5" Willov	w N 40° W	69.3 <b>0</b> '
5" Spruc	e N 20° E	44.22
4" Spruc	e S 50° W	19.80'
14" Spruc	e S 55° E	75.901

#### Description of corner evidence found:

Found a 2" x 30" iron pipe with a 4" x 4" white cedar post 0.9' east of iron pipe as established by County Survey in 1967 (see County Survey Records). THIS BOOK PAGE 105 AND

Also found Bearing Trees established in 1967 recorded as follows:

1 6 11 Cm	G / O G T		499.8	1		
16" Spruce	S 69° E	25.02'	scribed	UT 5 S	RIOW	S 4 BTCS"
24" Fir	NT 400 7 F1 79	70 mm1 (2) 1 mm - 1			1.0 1.0	D # DICD
Z1 - I I I I	14 40 12 E	59.57'@15°0'	scribed	$^{\prime\prime}$ T 4 S	R IO W	C 33 RTCCII
1 / 11 Cm 244 0 0	NT / 0 0 TIT					
14" Spruce	N 63° W	51.42	scribed	IIT 4 S	W Of C	S 32 BTCS"
1 / 16 TT = == 1-	0 000 001 777		~~~~~~	J. 3. D	TC TO YV	B 25 DICS.
14 Hemlock	S 49 30 W	70.25' @ 17° 0'	scribed	"T 5 S	R 10 W	S 5 BTCS"

# Description of monument and accessories I established to perpetuate the original location of this corner


At the position of the  $2'' \times 30''$  iron pipe, placed a  $2'' \times 30''$  galvanized iron pipe, flared at the bottom and brass cap riveted on the top and extends 3'' above the ground.

Sat 2" trappe glowy side (Stamped the disk -

From the pipe monument, the Bearing Trees are found to be:

	N 40° 15' E N 63° W	52.10'	scribed	"T 4 S	R 10 W	S 4 BTCS" S 33 BTCS" S 32 BTCS"
16" Hemlock						S 32 BTCS'' S 5 BTCS''

Placed a USFS Bearing Tree sign on each of the four trees at breast high and facing monument.

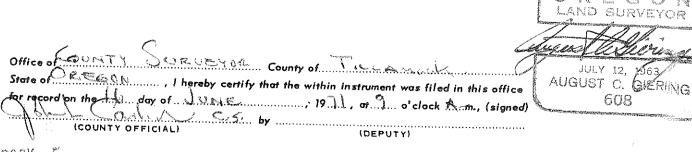

800K 5

CLARKS GROFF ENGINEERS, INC.

REGISTERED

T 4 S R 10 W

S

**S** 33

S 32

5

T 5 S

608