
County Surveyor's Record, Tillamook County, Oregon

Found a 3/4" iron pipe for corner as restored by M. Whitmore. I re-Feet placed this monument with a $2\frac{1}{2}$ " x 30" iron post with brass cap marked

T3S R9W

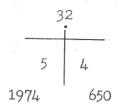

from which

A 12" Alder bears S55½°E, 22 lks Original scribing now gone. A 14" Alder bears S682°W, 52 1ks Original scribing now gone.

Placed a 3/4" iron pipe alongside brass cap.

The corner to Sections 32 and 33. Found a 1" iron pipe at position for corner. I replaced this with a $2\frac{1}{2}$ " x 30" iron post with brass cap marked

from which

The stump of an old Fir snag bears S40°E, 4 lks This is an original BT-scribing no longer visible.

L. Whitmore found a fallen 40" Fir snag N28°E, 26 lks (original BT), with axe marks, which is no longer there because of recent logging.

A 15" Alder bears N54°E, 14.9 feet to face Scribed T3S, R9W, S33BT.

A 22" Alder bears S64°E, 11.0 feet to face Scribed T4S, R9W, S4BT.

Continuing on line between T3 and 4S, R9W, enter cutover to North S89°43'09"正

1895 2434.75 Point for the North 1/4 corner to Section 4

I set a $2\frac{1}{2}$ " x 30" iron post with brass cap marked

T4S R9W

BOOK 5 '

1974 650

See my B-66/