CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

In 1898, Charles Branson subdivided T4S R9W WM under Contract #687. At the 1/4 8/9 he set an alder post 5' long 3"sq., 24" in the ground with a mound of stone 3' at base and 2 1/2' high west of corner, marked 1/4 S9 on East, 1/4 S8 on West faces from which;

T4S R9W 1/4 S8 S9

an alder 5" diam. bears S7 1/2°E 83 1/2 1ks (55.1') marked 1/4 S9 BT

an alder 5" diam. bears S24 1/2°W 158 1ks (104.3') Var. 21°45'E

In 1961, Leonard Whitmore, not finding the orig., set a 4" by 3' fir limb marked 1/4 S9 on the East and 1/4 S8 on West side and marked the following BT's.

a fir 14" diam. bears N70°E 11.5' marked 1/4 S9 BT

a fir 30" diam bears N64°W 26.0' marked 1/4 S8 BT This corner was not found.

Description of corner evidence found:

Monument found: mound of rocks with cedar post on East side. Origin of post unknown-not original.

BT's Found:

alder 18" diam bears S7 1/2°E 54.7' (record 55.1) healed face

alder snag 12" diam bears S24 1/2°W 104.3' chopped out, small piece of (Relief) scribing found. Can be seen at Hebo Ranger District.

Description of monument and accessories I established to perpetuate the

original location of this corner: Monument set—at the Easterly edge of rock mound, I set a 3" \times 30" aluminum cap with magnet in top and bottom marked T4S R9W


1/4 S8 S9 1983 RLS 1886

pile rocks around cap, put fiberglas post & decal 3' North.

BT's set:


a fir 16" diam bears N71°E 60.4 marked 1/4 S9 BT

a fir 31" diam bears S57°W 23.2' marked 1/4 S8 BT



Equipment used: Kesson tape 50° & rain "d" tape staff compass (Var 21°E)

Crew: Chesebro
Hunnemuller
Johnson, F.
//19/83

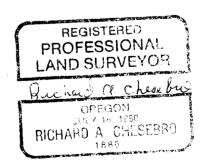

T4S

RLS

1/4

1983

R9W

1886

Office of County Surveyor	County ofTillamook
State of	that the within instrument was filed in this office
Allan & Duncan, C.S. by	
(COUNTY OFFICIAL)	(DEPUTY)

Form R6-7100-57 (9/71)

☆ GPO---798-276