
TILLAMOOK COUNTY SURVEYORS OFFICE COURTHOUSE, TILLAMOOK, OREGON 97141

SECTION CORNER COMMON TO SECTIONS 18 AND 19, TOWNSHIP 2 SOUTH, RANGE 8 WEST, WILLAMETTE MERIDIAN, TILLAMOOK COUNTY, OREGON.

I FOUND A 1-1/4" IRON PIPE WITH A 3" DIAMETER OREGON STATE BOARD OF FORESTRY BRASS DISK SET IN THE CENTER OF A 7.0' TALL, ROTTEN HEMLOCK STUMP WHICH IS THE REMAINS OF THE ORIGINAL CORNER TREE. THE ORIGINAL FIELD NOTES CALL FOR A 30" SPRUCE TREE. THE CAP WAS STAMPED AS SHOWN HEREON. I REFERENCED OUT THE POSITION OF THE FOUND BRASS CAP, REMOVED THE IRON PIPE AND CAP FROM THE TREE, REMOVED THE REMAINDER OF THE ROTTEN STUMP AND RESET THE FOUND MONUMENT AT GROUND SURFACE AND ENCASED THE MONUMENT IN CONCRETE AND A PLASTIC CYLINDER AND A MOUND OF ROCKS.

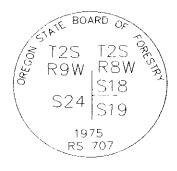

HISTORY OF FOUND MONUMENT

A CORNER TREE WAS ORIGINALLY SET BY THE GENERAL LAND OFFICE BY HENRY MELDRUM UNDER CONTRACT NUMBER 500, APRIL 24, 1884. THE CORNER WAS THEN RESTORED IN 1950 BY JOHN S. FORREST, DEPUTY, AND JAMES G. REID, UNDER THE AUTHORITY OF W.E. ANDERSON, P.E. 1697, TILLAMOOK COUNTY ENGINEER. THIS RESTORATION IS FILED IN REWITNESS BOOK 2, PAGE 34, TILLAMOOK COUNTY SURVEY RECORDS. THE BRONZE CAP WAS THEN ESTABLISHED IN THE CORNER TREE BY THE OREGON STATE DEPARTMENT OF FORESTRY IN 1975 AND FILED IN REWITNESS BOOK 5, PAGE 367, TILLAMOOK COUNTY SURVEY RECORDS.

THE MONUMENT WAS FOUND IN APRIL OF 2006 AS DESCRIBED ABOVE AND THE ACCESSORIES FOUND AND/OR SET AS FOLLOWS:

REWITNESS BOOK 2, PAGE 34 – SET A 1-1/2" IRON PIPE 5' LONG, 2-1/2' IN THE GROUND BETWEEN THE KNEES OF THE STUMP ON THE NORTH SIDE FOR SEC COR.; BOOK 5, PAGE 367 – FOUND 1-1/2" X 5' IRON PIPE 30" IN GROUND BETWEEN KNEES OF CORNER TREE STUMP ON NORTH SIDE (FOUND NORTH 36° EAST 0.8' FROM TRUE CENTER OF STUMP); 4-19-06 – FOUND BADLY RUSTED AND BENT IRON PIPE IN STUMP OF CORNER TREE AND PLACED IRON PIPE NEXT TO THE BRONZE CAP.

REWITNESS BOOK 2, PAGE 34 - A 16" DIAMETER HEMLOCK TREE SCRIBED "T2SR8WS18BT" WHICH BEARS NORTH 32° EAST 137'; BOOK 5, PAGE 367 – NOW 25" FACE GROWN OVER; 4-19-06 – FOUND ROTTEN STUMP WITH NO MARKS VISIBLE.

REWITNESS BOOK 2, PAGE 34 - A 6" DIAMETER HEMLOCK TREE SCRIBED "T2SR8WS19BT" WHICH BEARS SOUTH 47° EAST 127'; BOOK 5, PAGE 367 – NOW 16" FACE GROWN OVER; 4-19-06 – GONE.

REWITNESS BOOK 5, PAGE 367 – FOUND A 41" DIAMETER, 6' TALL HEMLOCK STUMP WITH SCRIBES "R8W" REMAINING ON PARTIALLY GROWN OVER FACE

ON NE SIDE AND "T2S" REMAINING ON PARTIALLY GROWN OVER FACE ON SE SIDE, THEN SET A 1-1/2" X 18" GALVANIZED IRON PIPE WITH 3" BRONZE CAP MARKED "OREGON STATE BOARD OF FORESTRY T2S R9W S24 T2S R8W S18 S19 1975 RS707", 16" IN CENTER OF CORNER TREE STUMP; 4-19-06 – FOUND 3" BRONZE CAP IN A BADLY DECAYED HEMLOCK STUMP WITH NO VISIBLE MARKS;

REWITNESS BOOK 5, PAGE 367 – FOUND ORIGINAL 8" DIAMETER SPRUCE WHICH BEARS SOUTH 28° EAST 15 LINKS NOW A 6" X 4' TALL STUB WITH SCRIBES "BT" VISIBLE ON EXPOSED FACE; 4-19-06 – GONE.

REWITNESS BOOK 5, PAGE 367 - ORIGINAL 18" DIAMETER SPRUCE WHICH BEARS NORTH 60° EAST 55 LINKS, MISSING IN CREEK BOTTOM.

REWITNESS BOOK 5, PAGE 367, FOUND HEMLOCK NORTH 16° WEST 66.6 FT. NOT MENTIONED IN ORIGINAL FIELD NOTES; NOW 26" X 5' TALL STUMP, SCRIBES "T2S R9W S13" REMAINING ON PARTIALLY GROWN OVER FACE; 4-19-06 – GONE.

REWITNESS BOOK 5, PAGE 367, A 12" DIAMETER ALDER WHICH BEARS SOUTH 46-1/2° EAST 50.5 FT. TO FACE, BARK SCRIBED "T2S R8W S19 BT"; 4-19-06 – FOUND ROTTEN 14" DIAMETER ALDER STUMP 7' TALL WITH NO VISIBLE SCRIBE MARKS AT RECORD POSITION.

REWITNESS BOOK 5, PAGE 367, A 17" DIAMETER SPRUCE WHICH BEARS NORTH 60° EAST 126.2 FT. TO FACE, SCRIBED "T2S R8W S18 BT RS707"; 4-19-06 — FOUND 19" DIAMETER SPRUCE WITH PARTIALLY HEALED FACE WITH SOME SCRIBING VISIBLE AT RECORD POSITION.

REWITNESS BOOK 5, PAGE 367, A 1' WIDE CREEK NORTH 38.0 FT., COURSE BEARS NORTH 81° WEST FROM SOUTH 64° EAST; 4-19-06 -- FOUND 1' WIDE CREEK NORTH 27'.

REWITNESS BOOK 5, PAGE 367, SET A 4" X 4" X 5' WHITE PAINTED CEDAR POST 4.4 FEET NE OF CORNER PIPE; 4-19-06 – GONE.

REWITNESS BOOK 5, PAGE 367, OREGON STATE FORESTRY DEPARTMENT METAL LOCATION POSTER ON 14" DIAMETER ALDER BEARING TREE; 4-19-06 – FOUND RUSTED METAL LOCATION POSTER.

REWITNESS BOOK 5, PAGE 367, OREGON STATE FORESTRY DEPARTMENT METAL LOCATION POSTER ON 8" DIAMETER SPRUCE TREE NORTH 64° WEST 10.4 FT.; 4-19-06 – FOUND ROTTEN 8" DIAMETER 7" TALL SPRUCE STUMP WITH RUSTED METAL LOCATION POSTER.

SURVEYS AND REWITNESSES OF RECORD

G.L.O. Contract #500, Surveyed by Henry Meldrum, April 1884.

G.L.O. Book 2S6 - 2S11, T2S R8W, Page 83, Tillamook County Survey Records.

Rewitness Book 2, Page 34, W.E. Anderson, P.E. 1697, 1950, Tillamook County Survey Records.

Rewitness Book 5, Page 367, Harold J. Russell, L.S. 707, Tillamook County Survey Records. BLM Oregon Field Notes Volume: OR-R0309 Pages: 0048.0 and 0049.0.

MAP B-466, Richard A. Morris, L.S. 401, November 1962

MAP B-712, Richard A. Morris, L.S. 401, March 1976

NEW ACCESSORIES

*A 6" DIAMETER NOBLE FIR TREE WHICH BEARS NORTH 46° EAST 49.45' SCRIBED "T2S R8W S18 BT" WITH A NAIL AND BRASS WASHER STAMPED "T.C. SURV" SET BETWEEN THE "B & T".

*SET A 72" LIGHT HAT SECTION POST NORTH 40° WEST 3.5' FROM MONUMENT.

SET A 5/8" X 30" REBAR WITH RED PLASTIC CAP STAMPED "TILLAMOOK CO. SURVEY" WHICH BEARS NORTH 50° 35' EAST 15.69'.

SET A 5/8" X 30" REBAR WITH RED PLASTIC CAP STAMPED "TILLAMOOK CO. SURVEY" WHICH BEARS SOUTH 57° 42' EAST 148.00'.

* INDICATES TILLAMOOK COUNTY YELLOW METAL LOCATION POSTER ATTACHED.

GEODETIC POSITION

LATITUDE = 45° 23' 14.83365 NORTH, LONGITUDE = 123° 43' 18.47517 WEST, NAD 83/91.

LOCATION OF MONUMENT

THIS SECTION CORNER IS LOCATED APPROXIMATELY 150 FEET NORTHWEST OF A LANDING AT THE END OF AN EXISTING LOGGING ROAD.

IN THE PRESENCE OF, AND REWITNESSED BY DANNY R. MCNUTT, TILLAMOOK COUNTY SURVEYOR AND JOE JENSEN, SURVEY SUPERVISOR, TILLAMOOK COUNTY SURVEYOR'S OFFICE.

April 19, 2006

TITLE:

PROFESSIONAL LAND SURVEYOR
Danny R Mc Nutt

REGISTERED

OREGON JULY 11, 2000 DANNY R. MCNUTT 49230

RENEWAL12 - 31- 06

