
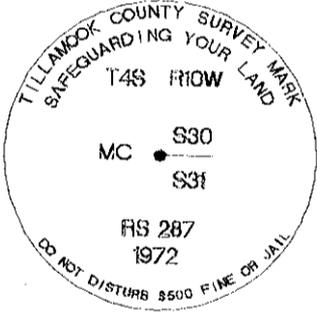
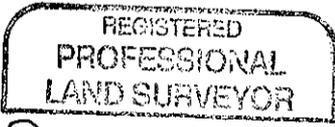



**OREGON PUBLIC LAND CORNER REPORT / RESTORATION REPORT**  
Tillamook County Surveyor's Office

<b>SECTION: Meander Corner of Section 30 and 31</b>	<b>TOWNSHIP 4 South</b>	<b>RANGE 10 West</b>
<b>COUNTY: Tillamook</b>		<b>DATE: 8-12-13</b>
<b>CORNER DESIGNATION:</b> The Meander Corner common to Sections 30 and 31, T. 4 S., R. 10 W., W.M.		<b>(Please check one)</b>
		<input checked="" type="checkbox"/> Condition Report Only
		<input type="checkbox"/> Restoration
		<input type="checkbox"/> Rewitness
		<input type="checkbox"/> Unrecorded
		<input type="checkbox"/> Reset at surface
		<input type="checkbox"/> Referenced Out
<b>Previous Rewitnesses, Restorations and Surveys, etc:</b> GLO notes in Book 4S10, page 43 1879, Hays Book "F", Page 49 (1887), Rewitness Book 4, Page 99 (1962), Rewitness Book 4, Page 102 (1962), Map A-1028 (1962), Map B-566 (1968), Rewitness Card #786 (1972), Map A-2349 (1972), Map A-3920 (1979), Map B-838 (1979), Partition Plat P-966 (2010), Tillamook County Survey Records.		
<b>Found Monument(s) and Accessories (Condition &amp; Source):</b> Original Corner was set by GLO in 1879. In 1972, the original spruce limb and record bearing trees were found as recorded in Rewitness Card #786. Tillamook County then remonumented the position with a 2" Iron Pipe with a 3" Brass Cap as shown below.  Found 3" dia. Tillamook County Brass Cap, in concrete. Found Hat Section Post 0.3' westerly (0.72' West) of the monument. Monument is stamped as shown hereon. The monument was then tied conventionally using GPS established control. The coordinates have been converted and are provided here in WGS 84, Latitude and Longitude. North = 45°11'17.23030", West= 123°56'54.09895"  (GLO) – Did not find the (72" Spruce bearing S 82° E 58 lks. [38.28']). (GLO) – Did not find the (40" Spruce bearing N 13° W 21 lks. [13.86']). (GLO) – Found (ascend hill; bears NW-SE; 50 lks. [33.0']). (Book 4, Page 99) – Found 22" dia. Alder (was 14"), (bearing N 80°30' E 22.2'), bark scribed with metal location tags. (Book 4, Page 99) – Found 44" dia. Spruce, (was 30"), (bearing S 27°30' E 40.2'), healed scar with metal location tags.  ( ) Indicates record information, Tillamook County Survey Records. [ ] Indicates record links converted to feet.		
<b>Monument Set (Procedures and Description):</b> N/A	<b>Sketch of Found Monument:</b> 	
<b>New Accessories set:</b> N/A		
<b>New Bearing Trees Marked:</b> N/A		
<b>Location &amp; Comments:</b> The monument is located approximately 80' Southwesterly of Brooten County Road, on the easterly edge of wetlands.		
<b>Firm / Agency</b> <b>Address:</b> TILLAMOOK COUNTY SURVEYOR'S OFFICE 1510 3 <sup>rd</sup> Street, Suite C Tillamook, Oregon 97141		<b>SURVEYOR'S SEAL</b>
<b>Party Chief:</b> Danny R. McNutt, P.L.S. 49230, Tillamook County Surveyor		
<b>Notes:</b> Digital images were taken of the monument and its accessories.		
<b>Witnesses:</b> Michael R. Rice, P.L.S. 86926, Survey Technician		 RENEWAL 12-31-2014

